


NOTE:
THIS DRAWING INDICATES AND ASSUMES THE USE OF
BPT COMPOSITE CABLES OR A SUITABLE EQUIVALENT.
ENSURE ALL ADDITIONAL CONNECTIONS ARE
A MINIMUM OF 0.5MM CSA PARALLEL CONDUCTORS.
INCORRECT CABLE SPEC CAN CAUSE DIGITAL
SIGNALING PROBLEMS.

NOTE: CABLE EQUIVAILMENTS
VCA/130 = RS49 COAX + 4 CORES @ 1.0MMSQ + 8 CORES @ 0.5MMSQ
VCA/60 = RS49 COAX + 2 CORES @ 1.0MMSQ + 3 CORES @ 0.5MMSQ

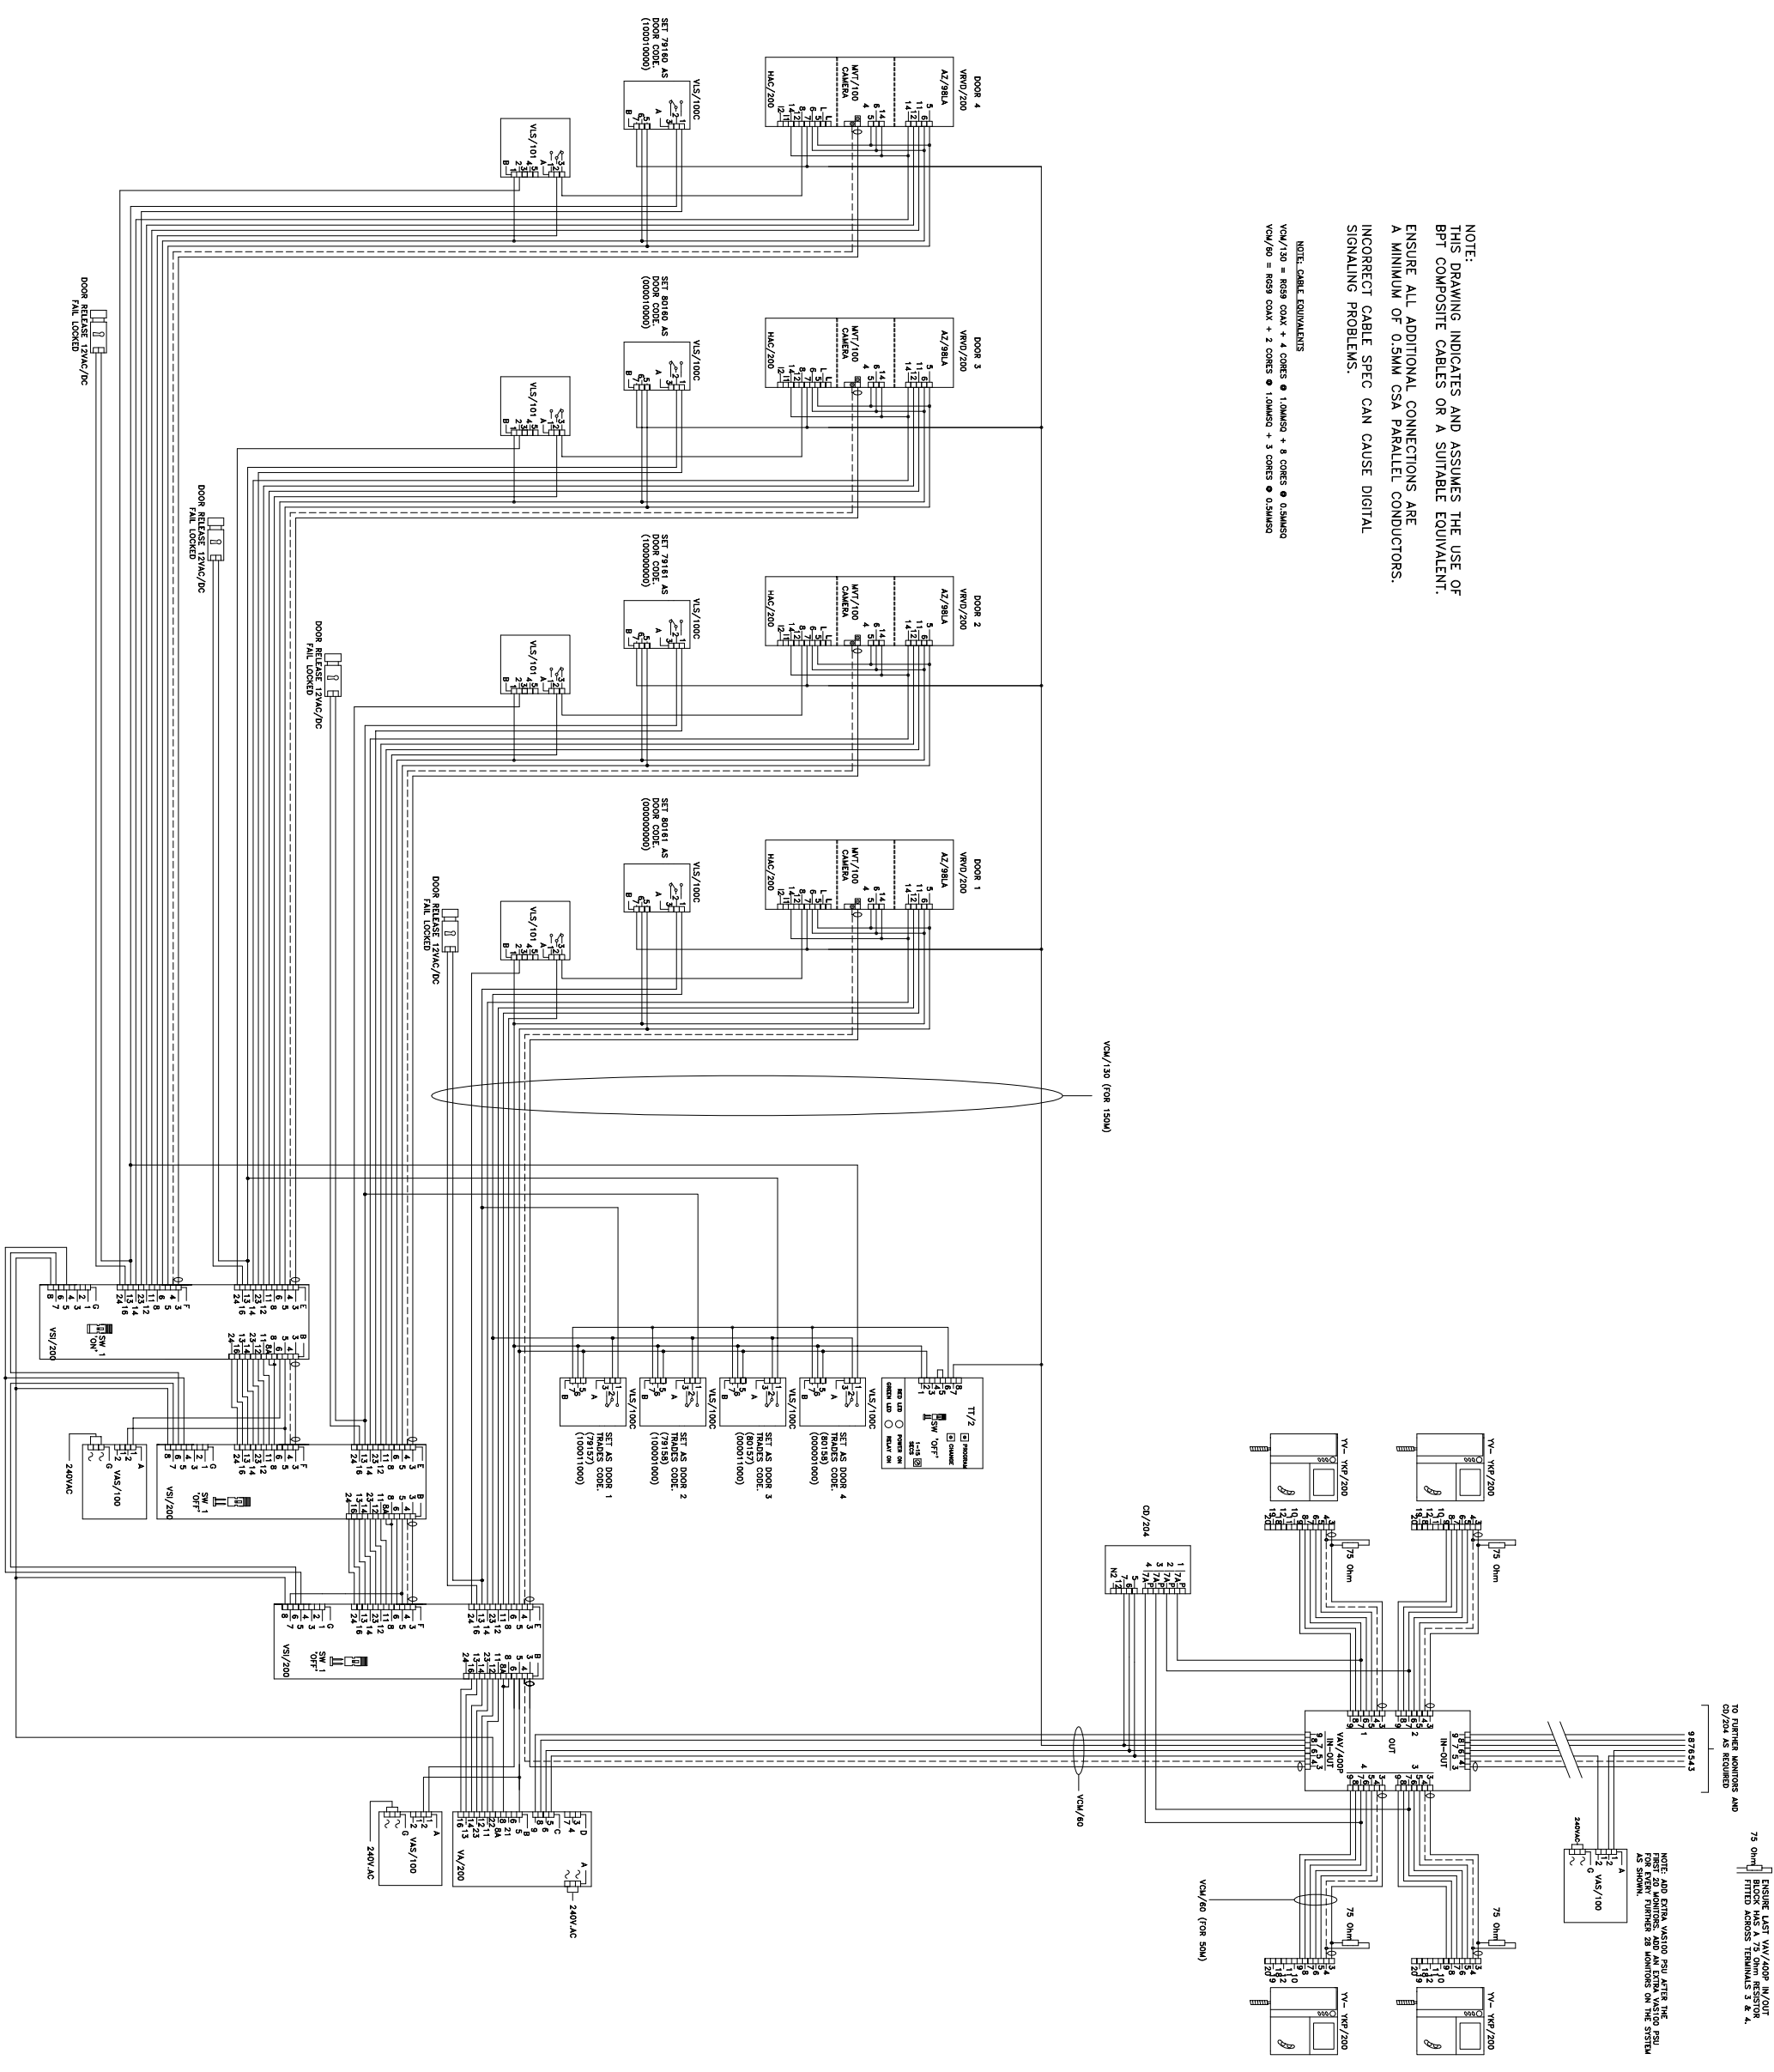

75 Ohm
ENSURE LAST VAV/ADP IN/OUT
BLOCK HAS A 75 Ohm RESISTOR
FITTED ACROSS TERMINALS 3 & 4.
TO OTHER MONITORS AND
CD/204 AS REQUIRED

NOTE: ADD EXTRA VAV100 PSU AFTER THE
FIRST 20 MONITORS AND AN EXTRA VAV100 PSU
AS SHOWN.

PREPARED FOR
BPT (UK) LTD.
HERTS. ENGLAND
INSTALLER INFORMATION
DATE: 13/01/06 DRAWN: RC
REVISED:
DRAWING TITLE: 4 X DIGITAL VR VIDEO ENTRY PANEL WITH
CODED ENTRY, TRADES & LYNEA MONITORS
DRAWING No: B-XV4YLVLT